

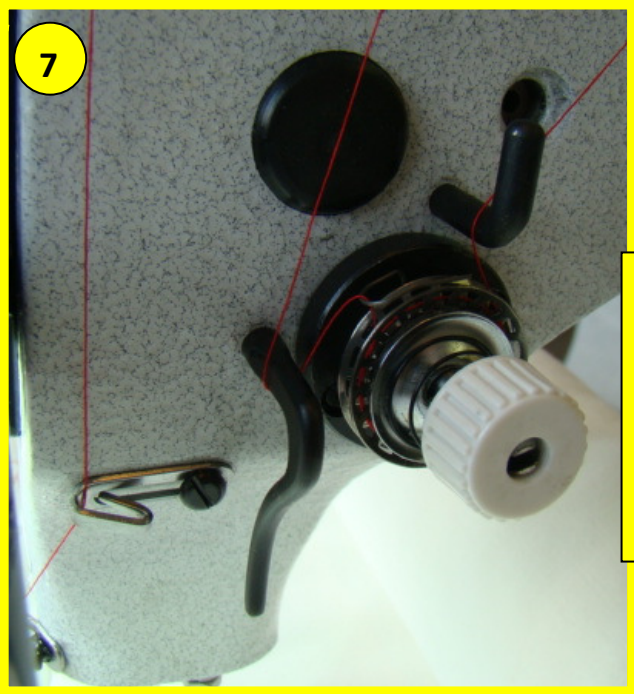


Threading Diagram – Gammill® Premier (Plus Model)

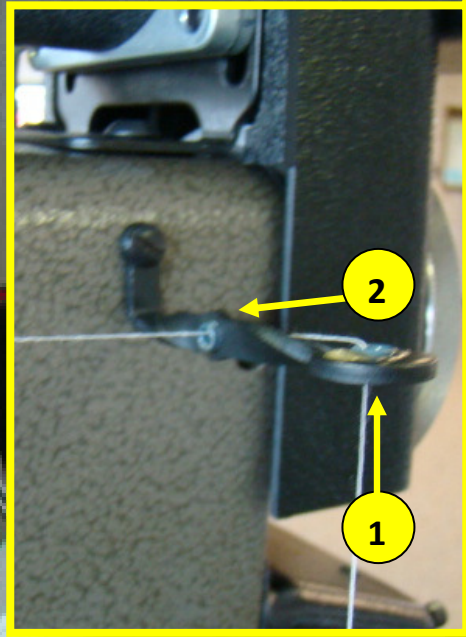

6. Insert thread up through the first hole, and back down through the third hole

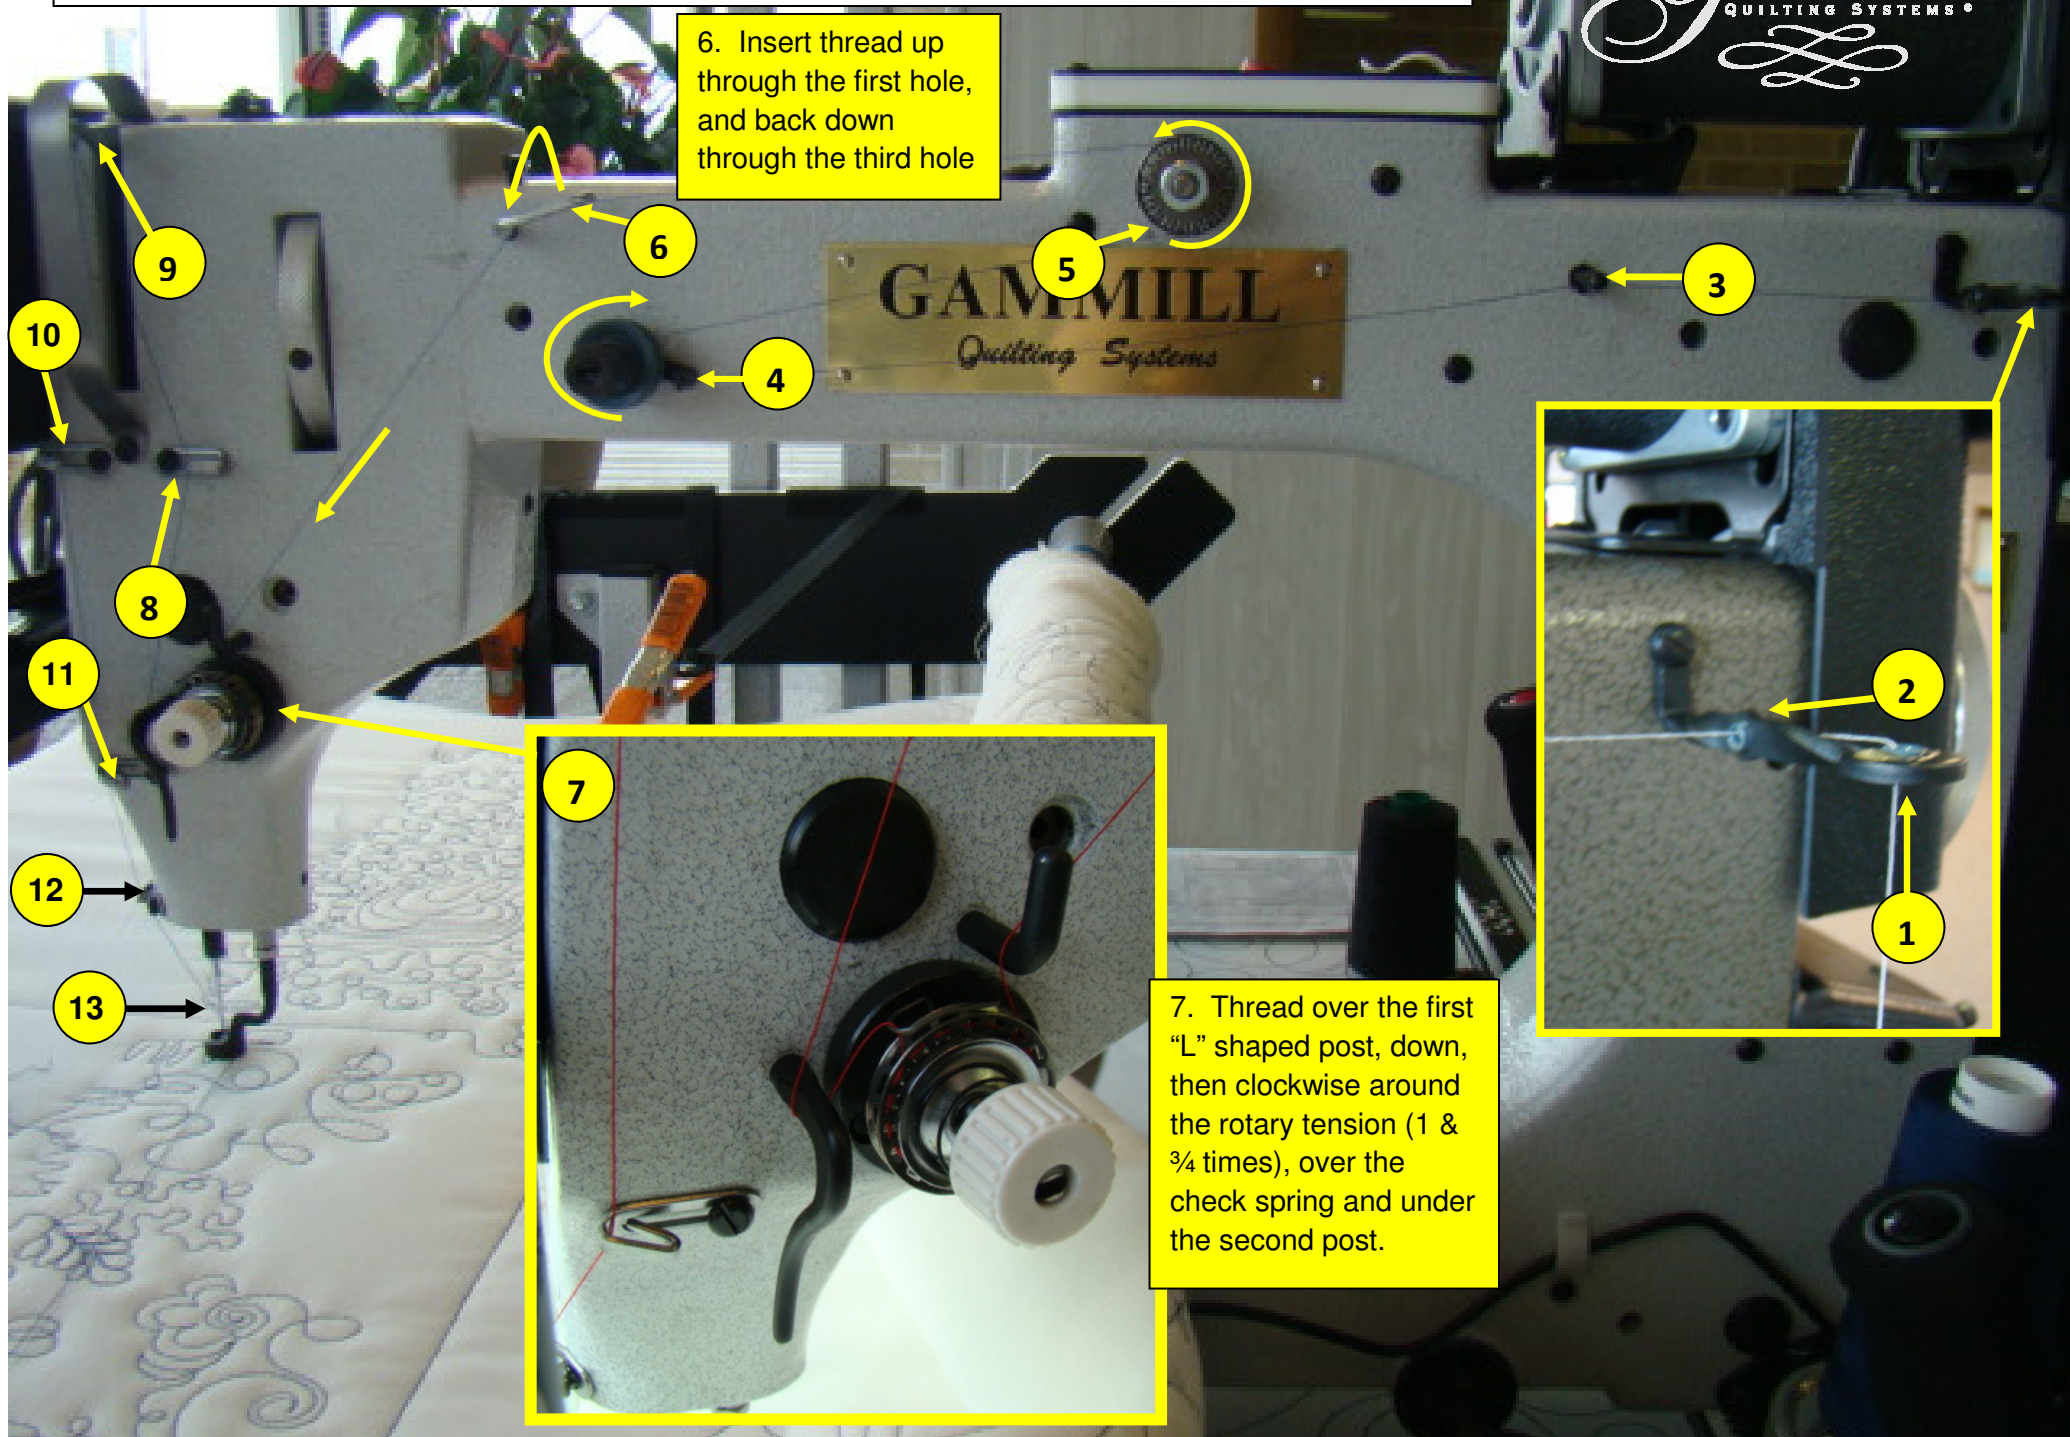

7. Thread over the first "L" shaped post, down, then clockwise around the rotary tension (1 & 3/4 times), over the check spring and under the second post.

- 9
- 10
- 8
- 11
- 12
- 13

- 6
- 4
- 5

- 3
- 2
- 1